DIAGNOSTIC TROUBLE CODE CHART

05601-02

Terms	Meaning	
Physical address	Three–digit code (shown in hexadecimal) which is given to each component comprising the AVC–LAN. Corresponding to the function, individual symbols are specified.	
Logical address	Two-digit code (shown in hexadecimal) which is given to each function comprising the inner system of the AVC-LAN.	

1. RADIO RECEIVER ASSY (Physical address: 190)

HINT:

- *1: Even if no failure is detected, it may be stored depending on the battery condition or voltage for starting an engine.
- *2: It is stored when 180 sec. has passed after the power supply connector is pulled out after engine start.
- *3: It may be stored when the engine key is turned 1 min. after engine start.
- *4: It may be stored when the engine key is turned again after engine start.
- *5: When 210 sec. has passed after pulling out the power supply connector of the master component with the ignition switch in ACC or ON, this code is stored.
- (a) Logical address: 01 (Communication control)

DTC	Diagnosis item	Description	Action to be taken
22	RAM Error	Abnormal condition of RAM is detected.	Replace radio receiver assy.
D6 *1	Absence of Master	Component in which this code is recorded had been disconnected from system or master component with ignition in ACC or ON.	Check harness for power supply system of radio receiver assy. Check harness for communication system of radio receiver assy.
D7 *5	Connection check Error	Component in which this code is recorded had been disconnected from system or master component ignition with in ACC or ON.	Check harness for power supply of radio receiver assy. Check harness for communication system of radio receiver assy.
D8 *2	No Response to Connection Check	Component shown by sub code is or had been disconnected from system after engine start.	Check harness for power supply system of component shown by sub code. Check harness for communication system of component shown by sub code.
D9 *1	Last Mode Error	Audio or visual component operated before engine stop is or had been disconnected with ignition switch in ACC or ON.	Check harness for power supply system of component shown by sub code. Check harness for communication system of component shown by sub code.
DA	No Response to ON/OFF Instruction	No response is identified when changing mode (audio and visual mode change). Detected when sound and picture does not change by button operation.	Check harness for power supply system of component shown by sub code. Check harness for communication system of component shown by sub code. If error occurs again, replace component shown by sub code.
DB *1	Mode Status Error	Dual alarm is detected.	Check harness for power supply of component shown by sub code. Check harness for communication system of component shown by sub code.
DC *3	Transmission Error	Transmission to component shown by auxiliary code has been failed. (Detecting this DTC does not necessarily mean actual failure.)	If same sub code is recorded in other com- ponent, check harness for power supply and communication system of all components shown by code. (If not, delete DTC and recheck.)

2004 COROLLA (RM1037U)

Author: Date: 770

DD *4	Master Reset (Momentary Interruption)	After engine is started, master component had been disconnected from system.	Check harness for power supply system of multi–display. Check harness for communication system of radio receiver assy. If this error occurs frequently, replace radio receiver assy.
DE *4	Slave Reset (Momentary Interruption)	After engine is started, component shown by sub code had been disconnected from system.	Check harness for power supply of component shown by sub code. Check harness for communication system of component shown by sub code.
E0 *1	Registration Completion Instruction Error	"Registration Completion Instruction" command from master cannot be received.	Since this DTC is provided for engineering purpose, it may be detected when no actual failure exists.
E2	ON/OFF Instruction Parameter Error	Error occures in ON/OFF controlling command from master component.	Replace radio receiver assy
E3 *1	Registration Request Transmission	Registration Request command is output from component shown by sub code. Receiving Connection Check Instruction, Registration Request command is output from sub–master component.	Since this DTC is provided for engineering purpose, it may be detected when no actual failure exists.

(b) Logical address: 61 (Cassette switch)

DTC	Diagnosis item	Description	Action to be taken
40	Mechanical Error of Media	Malfunction due to mechanical failure is identified. Or cassette tape is cut or entangled.	Inspect cassette tape. Replace radio receiver assy.
41	EJECT Error	Malfunction due to mechanical failure.	Replace radio receiver assy.
42	Tape caught in the radio receiver assy	Hub lock etc.	Inspect cassette tape.

(c) Logical address: 62 (CD player)

DTC	Diagnosis item	Description	Action to be taken
42	No Disc Readout	Disc cannot be read.	Inspect CD. Replace radio receiver assy.
44	CD player Error	Error is detected in CD player.	Replace radio receiver assy.
45	EJECT Error	Magazine cannot be ejected.	Replace radio receiver assy.
46	Scratched/Reversed Disc	Scratches or dirt is found on CD surface or CD is set upside down.	Inspect CD.

2004 COROLLA (RM1037U)

Author: Date: 771