

advises that the results of a full-scale fatigue test, conducted by Airbus Industrie, indicate that fatigue cracks were found on stringer 39 at frame 53-2 (left and right sides). These stringers are located in the center fuselage area of the airplane. Such fatigue cracking, if not detected and corrected in a timely manner, could result in reduced structural integrity of the fuselage.

Airbus Industrie has issued Service Bulletin A340-53-4009, dated August 2, 1994, which describes procedures for installing a doubler on stringer 39 at frame 53-2 (left and right sides). This doubler is intended to reinforce the frame, and prevent the initiation and propagation of damage due to fatigue cracking in this area. The DGAC classified this service bulletin as mandatory and issued French Airworthiness Directive (CN) 94-209-010(B), dated September 14, 1994, in order to assure the continued airworthiness of these airplanes in France.

This airplane model is manufactured in France and is type certificated for operation in the United States under the provisions of section 21.29 of the Federal Aviation Regulations (14 CFR 21.19) and the applicable bilateral airworthiness agreement. Pursuant to this bilateral airworthiness agreement, the DGAC has kept the FAA informed of the situation described above. The FAA has examined the findings of the DGAC, reviewed all available information, and determined that AD action is necessary for products of this type design that are certificated for operation in the United States.

Since an unsafe condition has been identified that is likely to exist or develop on other airplanes of the same type design, this AD is being issued to prevent reduced structural integrity of the fuselage due to the problems associated with fatigue cracking at stringer 39. This AD requires the installation of a doubler on stringer 39 at frame 53-2 (left and right sides). The actions are required to be accomplished in accordance with the service bulletin described previously.

There currently are no Model A340-211 and -311 series airplanes on the U.S. Register. All airplanes included in the applicability of this rule currently are operated by non-U.S. operators under foreign registry; therefore, they are not directly affected by this AD action. However, the FAA considers that this rule is necessary to ensure that the unsafe condition is addressed in the event that any of these subject airplanes are imported and placed on the U.S. Register in the future.

Should an affected airplane be imported and placed on the U.S. Register in the future, it would require approximately 8 work hours to accomplish the required actions, at an average labor charge of \$60 per work hour. Required parts would be supplied by the manufacturer at no cost to operators. Based on these figures, the total cost impact of this AD would be \$480 per airplane.

Since this AD action does not affect any airplane that is currently on the U.S. register, it has no adverse economic impact and imposes no additional burden on any person. Therefore, notice and public procedures hereon are unnecessary and the amendment may be made effective in less than 30 days after publication in the **Federal Register**.

#### Comments Invited

Although this action is in the form of a final rule and was not preceded by notice and opportunity for public comment, comments are invited on this rule. Interested persons are invited to comment on this rule by submitting such written data, views, or arguments as they may desire. Communications shall identify the Rules Docket number and be submitted in triplicate to the address specified under the caption **ADDRESSES**. All communications received on or before the closing date for comments will be considered, and this rule may be amended in light of the comments received. Factual information that supports the commenter's ideas and suggestions is extremely helpful in evaluating the effectiveness of the AD action and determining whether additional rulemaking action would be needed.

Comments are specifically invited on the overall regulatory, economic, environmental, and energy aspects of the rule that might suggest a need to modify the rule. All comments submitted will be available, both before and after the closing date for comments, in the Rules Docket for examination by interested persons. A report that summarizes each FAA-public contact concerned with the substance of this AD will be filed in the Rules Docket.

Commenters wishing the FAA to acknowledge receipt of their comments submitted in response to this rule must submit a self-addressed, stamped postcard on which the following statement is made: "Comments to Docket Number 95-NM-62-AD." The postcard will be date stamped and returned to the commenter.

The regulations adopted herein will not have substantial direct effects on the States, on the relationship between the national government and the States, or

on the distribution of power and responsibilities among the various levels of government. Therefore, in accordance with Executive Order 12612, it is determined that this final rule does not have sufficient federalism implications to warrant the preparation of a Federalism Assessment.

For the reasons discussed above, I certify that this action (1) is not a "significant regulatory action" under Executive Order 12866; (2) is not a "significant rule" under DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979); and (3) will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act. A final evaluation has been prepared for this action and it is contained in the Rules Docket. A copy of it may be obtained from the Rules Docket at the location provided under the caption **ADDRESSES**.

#### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

#### Adoption of the Amendment

Accordingly, pursuant to the authority delegated to me by the Administrator, the Federal Aviation Administration amends part 39 of the Federal Aviation Regulations (14 CFR part 39) as follows:

#### PART 39—AIRWORTHINESS DIRECTIVES

1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. App. 1354(a), 1421 and 1423; 49 U.S.C. 106(g); and 14 CFR 11.89.

#### § 39.13 [Amended]

2. Section 39.13 is amended by adding the following new airworthiness directive:

**95-12-21 Airbus:** Amendment 39-9273. Docket 95-NM-62-AD.

**Applicability:** Model A340-211 and -311 series airplanes; as listed in Airbus Service Bulletin A340-53-4009, dated August 2, 1994; certificated in any category.

**Note 1:** This AD applies to each airplane identified in the preceding applicability provision, regardless of whether it has been modified, altered, or repaired in the area subject to the requirements of this AD. For airplanes that have been modified, altered, or repaired so that the performance of the requirements of this AD is affected, the owner/operator must use the authority provided in paragraph (b) to request approval from the FAA. This approval may address either no action, if the current configuration eliminates the unsafe condition; or different