(c) Special flight permits may be issued in accordance with sections 21.197 and 21.199 of the Federal Aviation Regulations (14 CFR 21.197 and 21.199) to operate the airplane to a location where the requirements of this AD can be accomplished.

(d) The modification shall be done in accordance with Boeing Service Bulletin 737–53–1154, dated November 11, 1993. This incorporation by reference was approved by the Director of the Federal Register in accordance with 5 U.S.C. 552(a) and 1 CFR part 51. Copies may be obtained from Boeing Commercial Airplane Group, P.O. Box 3707, Seattle, Washington 98124–2207. Copies may be inspected at the FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington; or at the Office of the Federal Register, 800 North Capitol Street, NW., suite 700, Washington, DC.

(e) This amendment becomes effective on March 16, 1995.

Issued in Renton, Washington, on January 19, 1995.

Darrell M. Pederson,

Acting Manager, Transport Airplane Directorate, Aircraft Certification Service. [FR Doc. 95–1847 Filed 2–13–95; 8:45 am] BILLING CODE 4910–13–U

14 CFR Part 39

[Docket No. 93–NM–217–AD; Amendment 39–9128; AD 95–02–09]

Airworthiness Directives; British Aerospace Model ATP Airplanes

AGENCY: Federal Aviation Administration, DOT. ACTION: Final rule.

SUMMARY: This amendment adopts a new airworthiness directive (AD), applicable to certain British Aerospace Model ATP airplanes, that requires inspections to detect damage, overheating, and proper operation of the DC connections and cooling fans in certain transformer rectifier units (TRU), and repair or replacement, if necessary. This amendment is prompted by a report of the loss of all DC electrical power, except for the battery emergency bus, due to failure of the TRU's, which occurred during flight. The actions specified by this AD are intended to prevent such failures that could lead to loss of essential electrical power required to continue safe flight of the airplane.

DATES: Effective March 16, 1995. The incorporation by reference of certain publications listed in the regulations is approved by the Director of the Federal Register as of March 16, 1995.

ADDRESSES: The service information referenced in this AD may be obtained from Jetstream Aircraft, Inc., P.O. Box 16029, Dulles International Airport, Washington, DC 20041–6029. This information may be examined at the Federal Aviation Administration (FAA), Transport Airplane Directorate, Rules Docket, 1601 Lind Avenue, SW., Renton, Washington; or at the Office of the Federal Register, 800 North Capitol Street, NW., suite 700, Washington, DC.

FOR FURTHER INFORMATION CONTACT: William Schroeder, Aerospace Engineer, Standardization Branch, ANM–113, FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington 98055–4056; telephone (206) 227–2148; fax (206) 227–1320.

SUPPLEMENTARY INFORMATION: A proposal to amend part 39 of the Federal Aviation Regulations (14 CFR part 39) to include an airworthiness directive (AD) that is applicable to certain British Aerospace Model ATP airplanes was published in the **Federal Register** on February 18, 1994 (59 FR 8145). That action proposed to require inspections of the DC connections and cooling fans in certain transformer rectifier units (TRU) to detect damage or overheating and to ensure correct operation, and repair or replacement, if necessary.

Interested persons have been afforded an opportunity to participate in the making of this amendment. Due consideration has been given to the single comment received.

The commenter supports the rule. As a result of recent communications with the Air Transport Association (ATA) of America, the FAA has learned that, in general, some operators may misunderstand the legal effect of AD's on airplanes that are identified in the applicability provision of the AD, but that have been altered or repaired in the area addressed by the AD. The FAA points out that all airplanes identified in the applicability provision of an AD are legally subject to the AD. If an airplane has been altered or repaired in the affected area in such a way as to affect compliance with the AD, the owner or operator is required to obtain FAA approval for an alternative method of compliance with the AD, in accordance with the paragraph of each AD that provides for such approvals. A note has been added to this final rule to clarify this requirement.

Additionally, The FAA has recently reviewed the figures it has used over the past several years in calculating the economic impact of AD activity. In order to account for various inflationary costs in the airline industry, the FAA has determined that it is necessary to increase the labor rate used in these calculations from \$55 per work hour to \$60 per work hour. The economic impact information, below, has been revised to reflect this increase in the specified hourly labor rate.

After careful review of the available data, including the comments noted above, the FAA has determined that air safety and the public interest require the adoption of the rule with the changes previously described. The FAA has determined that these changes will neither increase the economic burden on any operator nor increase the scope of the AD.

The FAA estimates that 10 airplanes of U.S. registry will be affected by this AD, that it will take approximately 2 work hours per airplane to accomplish the required actions, and that the average labor rate is \$60 per work hour. Based on these figures, the total cost impact of the AD on U.S. operators is estimated to be \$1,200, or \$120 per airplane.

The total cost impact figure discussed above is based on assumptions that no operator has yet accomplished any of the requirements of this AD action, and that no operator would accomplish those actions in the future if this AD were not adopted.

The regulations adopted herein will not have substantial direct effects on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government. Therefore, in accordance with Executive Order 12612, it is determined that this final rule does not have sufficient federalism implications to warrant the preparation of a Federalism Assessment.

For the reasons discussed above, I certify that this action (1) Is not a "significant regulatory action" under Executive Order 12866; (2) is not a "significant rule" under DOT **Regulatory Policies and Procedures (44** FR 11034, February 26, 1979); and (3) will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act. A final evaluation has been prepared for this action and it is contained in the Rules Docket. A copy of it may be obtained from the Rules Docket at the location provided under the caption ADDRESSES.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

Adoption of the Amendment

Accordingly, pursuant to the authority delegated to me by the Administrator, the Federal Aviation Administration amends part 39 of the